


Step 1 Tabletop Assembly


- Lay all tabletop supports (C&D) out on a level surface with tabletop support C in the center
- Place 3 plastic boards (B) on top of the tabletop supports (C&D)
- Align the holes in the plastic boards (B) with the predrilled holes in the outer tabletop supports (D)
- Attach the plastic boards to the outer tabletop supports with (12) round head lag screws (I)
 Use supplied T-30 torx bit
- Align the holes in the center of the plastic boards (B) with the predrilled holes in center tabletop support (C)
- Secure the center tabletop support to the plastic boards working from the outside towards the center

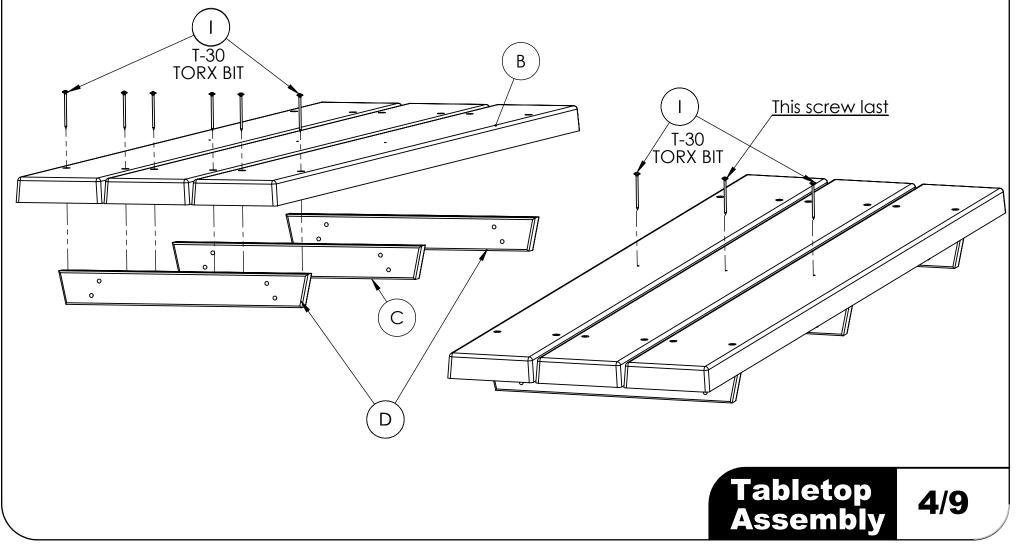


Step 2 Leg Assembly

- Turn the tabletop assembly upside down
- •
- Align the table legs (A) with the tabletop supports (C&D) Insert a 3/8" x 5.5" hex bolt (J) with a 3/8" flat washer (N) through the tabletop support (D) and table leg (A) Secure with a 3/8" flat washer (N) and 3/8" nylon lock nut (M) Repeat for each table leg Follow the leg placement shown below •

- Do not tighten bolts completely, this will be done last

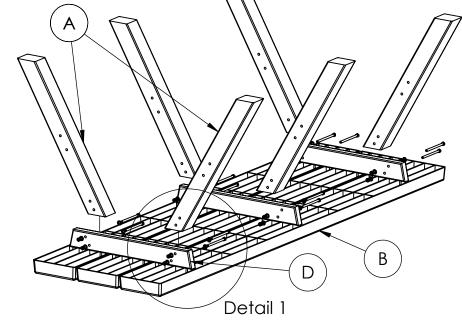

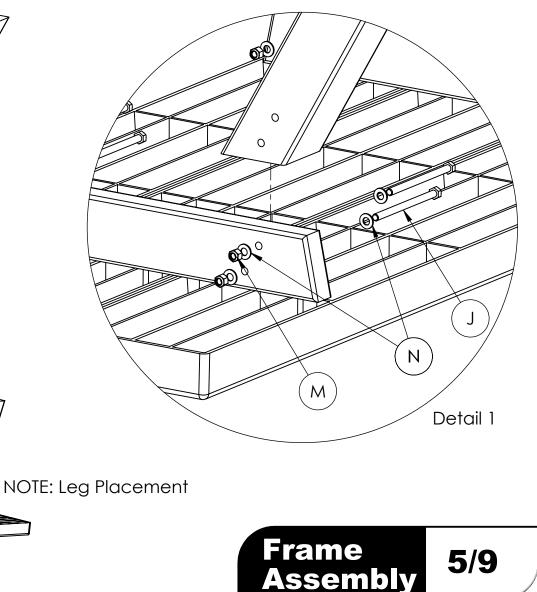


Step 3 Cross Seat Supports

Detail 2

Е

- Align the cross seat support (E) with an outside table leg (A)
- Insert a 3/8" x 5.5" hex bolt (J) with a 3/8" flat ٠ washer (N) through each hole in the cross seat support (E) and table leg (A) Secure with a 3/8" flat washer (N) and 3/8" nylon
- lock nut (M)
- Repeat for the other cross seat support (E) and the center cross seat support (G) Note the location on the table legs below ٠
- •

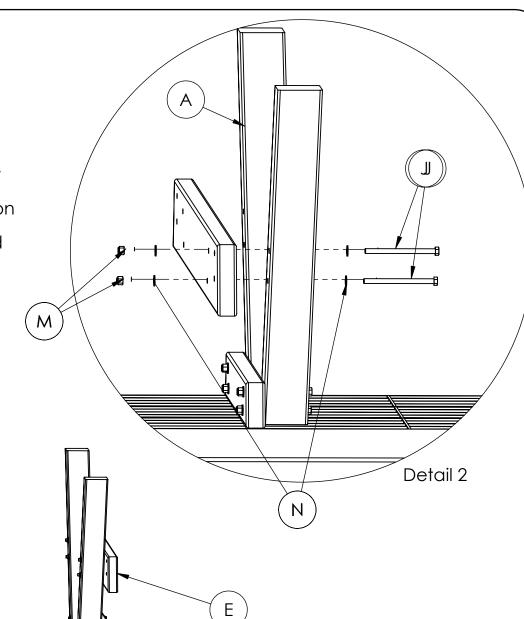

Frame

Assembly

6/9

NOTE: Cross seat support locations


G


Step 4 Triangle Supports

- Place the under seat supports (H) on a level surface
- Align the predrilled holes in the under seat support (H) and the triangle support (F)
- Secure (4) triangle supports (F) to each under seat support (H) with #12 x 2.5" pan head screws (K)

Step 5 Under Seat Supports


- Place the under seat suport (H) in between the cross seat supports (E)
- Align the predrilled holes in the face of the cross seat support (E) with the predrilled holes in the end of the under seat support (H)
- Secure each end with 3/8" x 3" hex lag bolt (L) and a 3/8" flat washer (N) per each hole
- Secure the under seat support to the center cross seat support (G) with 3/8" x 3" hex lag bolt (L) and a 3/8" flat washer (N) per each hole
- Repeat for the opposite side

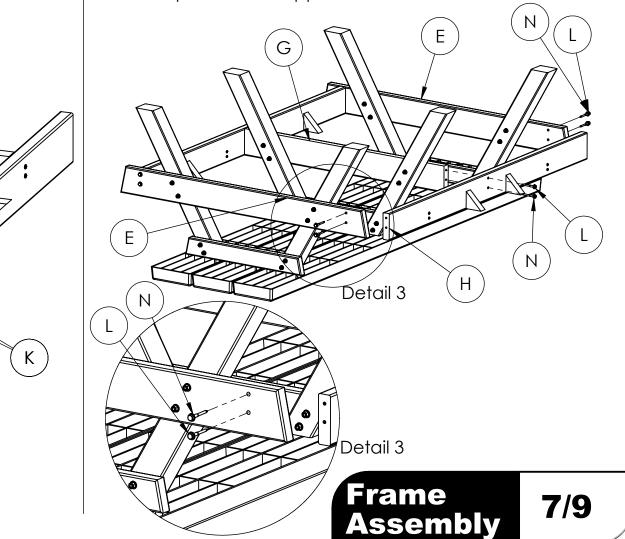

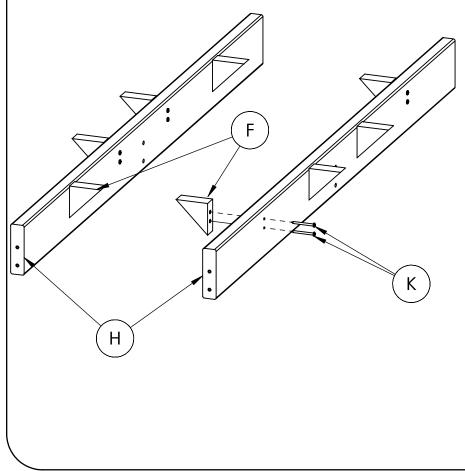


Step 6 Seat Assembly


- With 2 people, carefully turn the table right side up Place a plastic board (B) over the under seat support (H) Align the holes in the plastic board (B) with the predrilled holes in the under seat support (H)
- Secure the plastic board (B) with (1) round head lag screw (I) per hole. Use supplied T-30 torx bit
- Repeat for the opposite seat area
- Square all parts and tighten all hardware

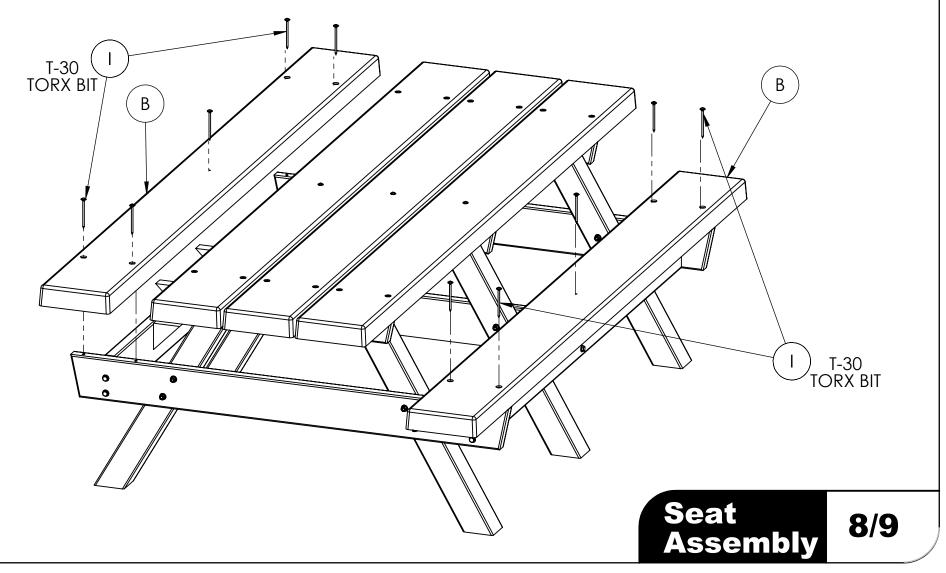




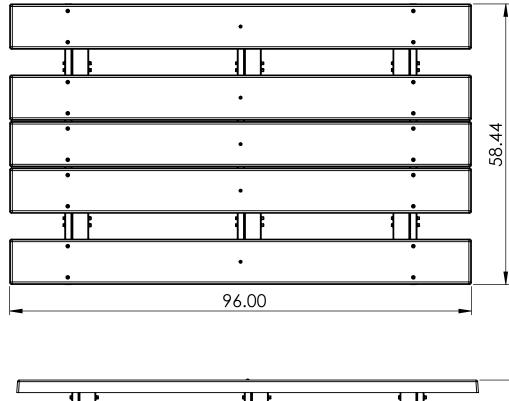


REV# 2 8-8-2018

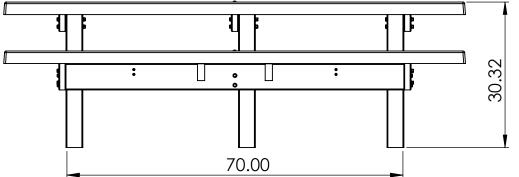

CONSTRUCTION MATERIALS: LEGS - 4X4 RECYCLED PLASTIC LUMBER SEATS & TABLE TOP - HDPE PLASTIC SEAT SUPPORTS - 2X6 RECYCLED PLASTIC LUMBER HARDWARE: STAINLESS STEEL

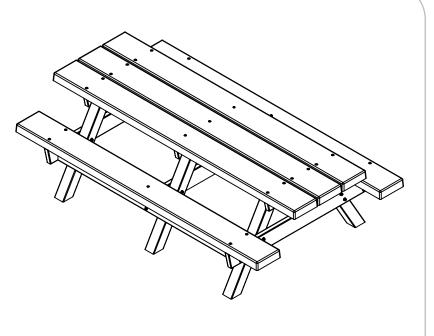

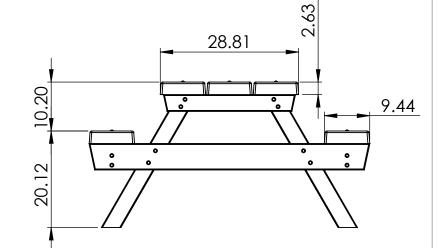

ALL DIMENSIONS SHOWN IN INCHES